


True RMS Multimeter with IR Thermometer

Extech EX570

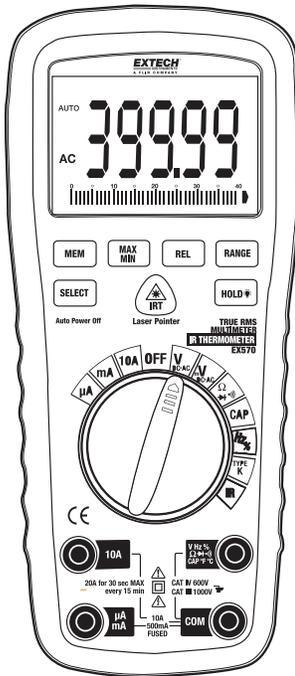

Introduction

Congratulations on your purchase of the Extech EX570 True RMS Autoranging Multimeter. This meter measures AC/DC Voltage, AC/DC Current, Resistance, Capacitance, Frequency, Duty Cycle, Diode Test, and Continuity plus Thermocouple Temperature and InfraRed Temperature. It features a waterproof, rugged design for heavy duty use. Proper use and care of this meter will provide many years of reliable service.

Safety



 
This symbol adjacent to another symbol, terminal or operating device indicates that the operator must refer to an explanation in the Operating Instructions to avoid personal injury or damage to the meter.

WARNING

This **WARNING** symbol indicates a potentially hazardous situation, which if not avoided, could result in death or serious injury.

CAUTION

This **CAUTION** symbol indicates a potentially hazardous situation, which if not avoided, may result damage to the product.



This symbol advises the user that the terminal(s) so marked must not be connected to a circuit point at which the voltage with respect to earth ground exceeds (in this case) 1000 VAC or VDC.



This symbol adjacent to one or more terminals identifies them as being associated with ranges that may, in normal use, be subjected to particularly hazardous voltages. For maximum safety, the meter and its test leads should not be handled when these terminals are energized.



This symbol indicates that a device is protected throughout by double insulation or reinforced insulation.

PER IEC1010 OVERVOLTAGE INSTALLATION CATEGORY

OVERVOLTAGE CATEGORY I

Equipment of OVERVOLTAGE CATEGORY I is equipment for connection to circuits in which measures are taken to limit the transient overvoltages to an appropriate low level.

Note – Examples include protected electronic circuits.

OVERVOLTAGE CATEGORY II

Equipment of OVERVOLTAGE CATEGORY II is energy-consuming equipment to be supplied from the fixed installation.

Note – Examples include household, office, and laboratory appliances.

OVERVOLTAGE CATEGORY III

Equipment of OVERVOLTAGE CATEGORY III is equipment in fixed installations.

Note – Examples include switches in the fixed installation and some equipment for industrial use with permanent connection to the fixed installation.

OVERVOLTAGE CATEGORY IV

Equipment of OVERVOLTAGE CATEGORY IV is for use at the origin of the installation.

Note – Examples include electricity meters and primary over-current protection equipment

CAUTIONS

- Improper use of this meter can cause damage, shock, injury or death. Read and understand this user manual before operating the meter.
- Always remove the test leads before replacing the battery or fuses.
- Inspect the condition of the test leads and the meter itself for any damage before operating the meter.
- Use great care when making measurements if the voltages are greater than 25 VAC rms or 35 VDC. These voltages are considered a shock hazard.
- Warning! This is a class A equipment. This equipment can cause interferences in the living quarters; in this case the operator can be required to carry out adequate measures.
- Always discharge capacitors and remove power from the device under test before performing Diode, Resistance or Continuity tests.
- Voltage checks on electrical outlets can be difficult and misleading because of the uncertainty of connection to the recessed electrical contacts. Other means should be used to ensure that the terminals are not "live".
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.
- This device is not a toy and must not reach children's hands. It contains hazardous objects as well as small parts that the children could swallow. In case a child swallows any of them, please contact a physician immediately
- Do not leave batteries and packing material lying around unattended; they can be dangerous for children if they use them as toys
- In case the device is going to be unused for an extended period of time, remove the batteries to prevent them from draining
- Expired or damaged batteries can cause cauterization on contact with the skin. Always, therefore, use suitable hand gloves in such cases
- See that the batteries are not short-circuited. Do not throw batteries into the fire.

SAFETY INSTRUCTIONS

This meter has been designed for safe use, but must be operated with caution. The rules listed below must be carefully followed for safe operation.


1. **NEVER** apply voltage or current to the meter that exceeds the specified maximum:

| Input Protection Limits | |
|--|--|
| Function | Maximum Input |
| V DC or V AC | 1000 VDC/AC rms |
| mA AC/DC | 500 mA 1000V fast acting fuse |
| A AC/DC | 10A 1000V fast acting fuse (20A for 30 seconds max every 15 minutes) |
| Frequency, Resistance, Capacitance, Duty Cycle, Diode Test, Continuity | 1000 VDC/AC rms |
| Temperature | 1000 VDC/AC rms |

2. **USE EXTREME CAUTION** when working with high voltages.
3. **DO NOT** measure voltage if the voltage on the "COM" input jack exceeds 600V above earth ground.
4. **NEVER** connect the meter leads across a voltage source while the function switch is in the current, resistance, or diode mode. Doing so can damage the meter.
5. **ALWAYS** discharge filter capacitors in power supplies and disconnect the power when making resistance or diode tests.
6. **ALWAYS** turn off the power and disconnect the test leads before opening the covers to replace the fuse or batteries.
7. **NEVER** operate the meter unless the back cover and the battery and fuse covers are in place and fastened securely.
8. If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

Controls and Jacks

1. IR Thermometer
2. Laser Pointer
3. 40,000 count LCD
4. MAX/MIN button
5. MEMORY button
6. SELECT button
7. Function switch
8. mA, μ A and 10A input jacks
9. PEAK and RELATIVE button
10. RANGE button
11. HOLD and  (Backlight) button
12. IR Thermometer button
13. Positive input jack
14. COM input jack

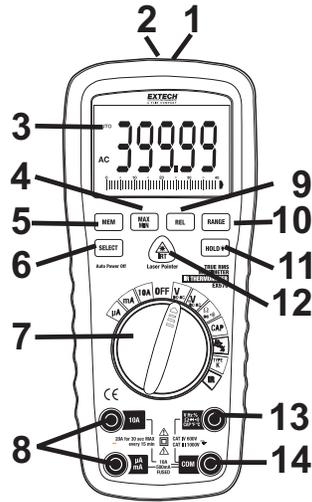


Note: Tilt stand and battery compartment are on rear of unit.

Symbols and Enunciators

| | |
|--|-----------------------------------|
| •))) | Continuity |
|  | Diode test |
|  | Low Battery |
| MEM | Memory |
| n | nano (10^{-9}) (capacitance) |
| μ | micro (10^{-6}) (amps, cap) |
| m | milli (10^{-3}) (volts, amps) |
| A | Amps |
| k | kilo (10^3) (ohms) |
| F | Farads (capacitance) |
| M | mega (10^6) (ohms) |
| Ω | Ohms |
| Hz | Hertz (frequency) |
| % | Percent (duty ratio) |
| AC | Alternating current |
| DC | Direct current |
| $^{\circ}$ F | Degrees Fahrenheit |
| MAX | Maximum |

| | |
|--------------|--------------------|
| APO | Auto Power Off |
| P | Peak |
| V | Volts |
| REL | Relative |
| AUTO | Autoranging |
| HOLD | Display hold |
| $^{\circ}$ C | Degrees Centigrade |
| MIN | Minimum |

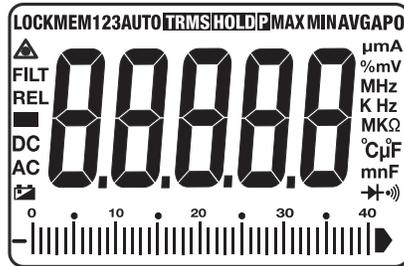

Operating Instructions


WARNING: Risk of electrocution. High-voltage circuits, both AC and DC, are very dangerous and should be measured with great care.

1. ALWAYS turn the function switch to the **OFF** position when the meter is not in use.
2. If "OL" appears in the display during a measurement, the value exceeds the range you have selected. Change to a higher range.

AC/DC VOLTAGE MEASUREMENTS

CAUTION: Do not measure DC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.


1. Rotate the function switch to the **V** position.
2. Press the **SELECT** button to display "**DC**" or "**AC**" on the LCD
3. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **V** jack.
4. Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
5. Read the voltage in the display.

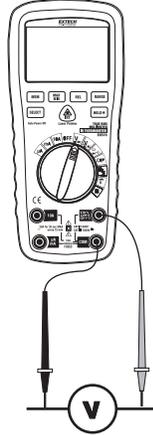

DC/AC MILLIVOLT MEASUREMENTS

CAUTION: Do not measure DC/AC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.

1. Rotate the function switch to the **mV DC-AC** position.
2. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **V** jack.
3. Press the **SELECT** button to select "**DC**" or "**AC**" millivolts.
4. Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
5. Read the voltage in the display.

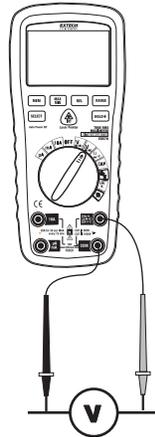

AC/DC CURRENT MEASUREMENTS

CAUTION: Do not make 20A current measurements for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.


1. Insert black test lead banana plug into the negative **COM** jack.
2. For current measurements up to 4000 μ A DC, set the function switch to the **μ A** position and insert the red test lead banana plug into the **μ A/mA** jack.
3. For current measurements up to 400 mA DC, set the function switch to the **mA** position and insert the red test lead banana plug into the **μ A/mA** jack.
4. For current measurements up to 20A DC, set the function switch to the **10A/HZ/%** position and insert the red test lead banana plug into the **10A** jack.
5. Press the **SELECT** button to indicate “**DC**” or “**AC**” on the display.
6. Remove power from the circuit under test, then open up the circuit at the point where you wish to measure current.
7. Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
8. Apply power to the circuit.
9. Read the current in the display.



RESISTANCE MEASUREMENTS

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any resistance measurements. Remove the batteries and unplug the line cords.


1. Rotate the function switch to the **Ω** position.
2. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **Ω** jack.
3. Press the **SELECT** button to indicate “ **Ω** ” on the display.
4. Touch the test probe tips across the circuit or part under test. It is best to disconnect one side of the part under test so the rest of the circuit will not interfere with the resistance reading.
5. Read the resistance in the display.

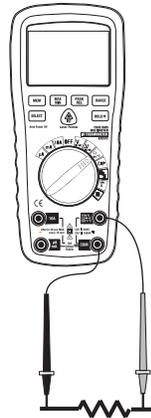

CONTINUITY CHECK


WARNING: To avoid electric shock, never measure continuity on circuits or wires that have voltage on them.

1. Rotate the function switch to the Ω  position.
2. Insert the black lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive Ω jack.
3. Press the **SELECT** button to indicate "" on the display.
4. Touch the test probe tips to the circuit or wire you wish to check.
5. If the resistance is less than approximately 35Ω , the audible signal will sound. If the circuit is open, the display will indicate "**OL**".

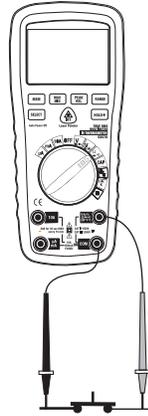

DIODE TEST


1. Rotate the function switch to the green Ω  position.
2. Insert the black test lead banana plug into the negative **COM** jack and the red test lead banana plug into the positive **V** jack.
3. Press the **SELECT** button to indicate " " and "**V**" on the display.
4. Touch the test probes to the diode under test. Forward voltage will typically indicate 0.400 to 0.700V. Reverse voltage will indicate "**OL**". Shorted devices will indicate near 0V and an open device will indicate "**OL**" in both polarities.

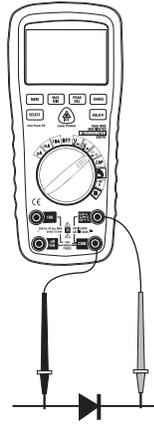

NON-CONTACT INFRARED TEMPERATURE MEASUREMENTS


1. Rotate the function switch to the **IR** position.
2. Press the **SELECT** button to select °F or °C.
3. Aim the infrared sensor (top of meter) at the surface to be measured.
4. Press the **IRT** button to turn on the IR thermometer and laser pointer. The laser pointer identifies the surface spot to be measured.
5. The area of the surface to be measured must be larger than the spot size as determined by the distance to spot size specification.
6. Read the temperature in the display. When the IRT button is released the displayed temperature will be held for approximately 10 seconds.

WARNING: Do not directly view or direct the laser pointer at an eye. Low power visible lasers do not normally present a hazard, but may present some potential for hazard if viewed directly for extended periods of time.

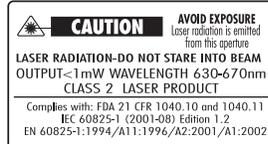

IR Spot to Distance Diagram

The 30:1 spot to distance ratio determines the size of the measured surface area with respect to the distance the meter is held away from the surface.

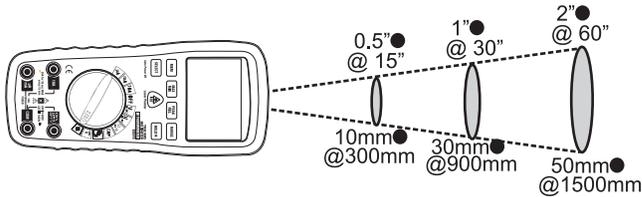

IR Measurement Notes


1. The object under test should be larger than the spot (target) size calculated by the field of view diagram.
2. If the surface of the object under test is covered with frost, oil, grime, etc., clean before taking measurements.
3. If an object's surface is highly reflective, apply masking tape or flat black paint to the surface before measuring.
4. The meter will not make measurements through glass.
5. Steam, dust, smoke, etc. can obscure measurements.
6. To find a hot spot, aim the meter outside the area of interest then scan across (in an up and down motion) until the hot spot is located.

THERMOCOUPLE TEMPERATURE MEASUREMENTS

1. Rotate the function switch to the **TYPE K** position.
2. Insert the Temperature Probe into the input jacks, making sure to observe the correct polarity.
3. Press the **SELECT** button to indicate "°F" or "°C"
4. Touch the Temperature Probe head to the part whose temperature you wish to measure. Keep the probe touching the part under test until the reading stabilizes.
5. Read the temperature in the display.

Note: The temperature probe is fitted with a type K mini connector. A mini connector to banana connector adaptor is supplied for connection to the input banana jacks.


Note: The temperature range of the supplied thermocouple probe is -20 to 250°C (-4 to 482°F)

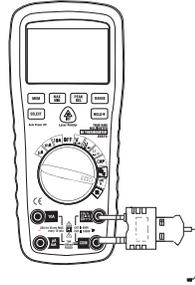

CAPACITANCE MEASUREMENTS


WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any capacitance measurements. Remove the batteries and unplug the line cords.

1. Rotate the function switch to the **CAP** position.
2. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **V** jack.
3. Touch the test leads to the capacitor to be tested.
4. Read the capacitance value in the display

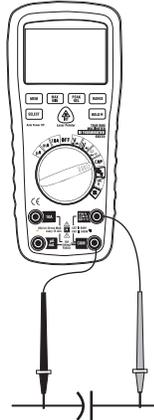

FREQUENCY (DUTY CYCLE) MEASUREMENTS

1. Rotate the function switch to the **Hz/%** position.
2. Insert the black lead banana plug into the negative **COM** jack and the red test lead banana plug into the positive **Hz** jack.
3. Touch the test probe tips to the circuit under test.
4. Read the frequency on the display.
5. Press the **SELECT** button to indicate "%".
6. Read the % duty cycle in the display.

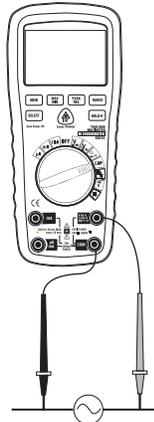

MEMORY

The meter can store and recall up to 3 readings.

Storing readings:

1. Press and Hold the **MEM** button until "**MEM1**" (with a flashing 1) appears in the display. Memory 1 is ready to accept data.
2. Press and release the **MEM** button to step through and select memories 2 or 3.
3. Press and Hold the **MEM** button to store the displayed value into the memory selected.
4. After storing the reading, the meter will return to normal operation.

Recalling readings:

1. Press and release the **MEM** button. "**MEM1**" and the stored value will appear in the display.
2. Press and release the **MEM** again button to step through and view memories 2 and 3.
3. Press and release the **MEM** again button to return to normal operation.

AUTORANGING/MANUAL RANGE SELECTION

When the meter is first turned on, it automatically goes into AutoRanging. This automatically selects the best range for the measurements being made and is generally the best mode for most measurements. For measurement situations requiring that a range be manually selected, perform the following:

1. Press the **RANGE** key. The "**AUTO**" display indicator will turn off.
2. Press the **RANGE** key to step through the available ranges until you select the range you want.
3. To exit the Manual Ranging mode and return to Autoranging, press and hold the **RANGE** key for 2 seconds.

Note: Manual ranging does not apply for the Temperature functions.

MAX/MIN

1. Press the **MAX/MIN** key to activate the MAX/MIN recording mode. The display icon "**MAX**" will appear. The meter will display and hold the maximum reading and will update only when a new "max" occurs.
2. Press the **MAX/MIN** key again and the display icon "**MIN**" will appear. The meter will display and hold the minimum reading and will update only when a new "min" occurs.
3. To exit MAX/MIN mode press and hold the **MAX/MIN** key for 2 seconds.

Relative mode

The relative measurement feature allows you to make measurements relative to a stored reference value. A reference voltage, current, etc. can be stored and measurements made in comparison to that value. The displayed value is the difference between the reference value and the measured value.

1. Perform the measurement as described in the operating instructions.
2. Press and Hold the **REL** button to store the reading in the display and the "REL" indicator will appear on the display.
3. The display will now indicate the difference between the stored value and the measured value.
4. Press and Hold the **REL** button to exit the relative mode.

PEAK HOLD

The Peak Hold function captures the peak AC voltage or current. The meter can capture negative or positive peaks as fast as 1 millisecond in duration. Press the **PEAK** button. "P_{MAX}" will appear in the display. The meter will update the display each time a higher positive peak occurs. Press the **PEAK** button again to exit the mode.

DISPLAY BACKLIGHT

Press the **HOLD**/ key for >1 second to turn the backlight on. The backlight will automatically turn off after 10 seconds.

HOLD

The hold function freezes the reading in the display. Press the **HOLD** key momentarily to activate or to exit the **HOLD** function.

LOW BATTERY INDICATION

When the low battery  icon appears in the display, the battery should be replaced.

AUTO POWER OFF

The auto off feature will turn the meter off after 15 minutes. To disable the auto power off feature, hold down the **SELECT** button and turn the meter on. "A_{PO} d" will appear in the display. Turn the meter off and then on again to re-enable the auto power off feature.

Maintenance

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the back cover or the battery or fuse covers.

WARNING: To avoid electric shock, do not operate your meter until the battery and fuse covers are in place and fastened securely.

This MultiMeter is designed to provide years of dependable service, if the following care instructions are performed:

1. **KEEP THE METER DRY.** If it gets wet, wipe it off.
2. **USE AND STORE THE METER IN NORMAL TEMPERATURES.** Temperature extremes can shorten the life of the electronic parts and distort or melt plastic parts.
3. **HANDLE THE METER GENTLY AND CAREFULLY.** Dropping it can damage the electronic parts or the case.
4. **KEEP THE METER CLEAN.** Wipe the case occasionally with a damp cloth. DO NOT use chemicals, cleaning solvents, or detergents.
5. **USE ONLY FRESH BATTERIES OF THE RECOMMENDED SIZE AND TYPE.** Remove old or weak batteries so they do not leak and damage the unit.
6. **IF THE METER IS TO BE STORED FOR A LONG PERIOD OF TIME,** the batteries should be removed to prevent damage to the unit.

BATTERY INSTALLATION

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery cover.


1. Turn power off and disconnect the test leads from the meter.
2. Open the rear battery cover by removing two screws (B) using a Phillips head screwdriver.
3. Insert the battery into battery holder, observing the correct polarity.
4. Put the battery cover back in place. Secure with the screws.

WARNING: To avoid electric shock, do not operate the meter until the battery cover is in place and fastened securely.

NOTE: If your meter does not work properly, check the fuses and batteries to make sure that they are still good and that they are properly inserted.

REPLACING THE FUSES

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the meter cover.

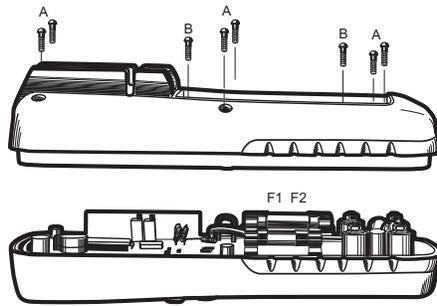

1. Disconnect the test leads from the meter.
2. Remove the battery cover (two "B" screws) and the battery.
3. Remove the six "A" screws securing the rear cover.
4. Gently remove the old fuse and install the new fuse into the holder.
5. Always use a fuse of the proper size and value (0.5A/1000V fast blow for the 600 mA range [SIBA 70-172-40], 10A/1000V fast blow for the 10A range [SIBA 50-199-06]).
6. Replace and secure the rear cover, battery and battery cover.

WARNING: To avoid electric shock, do not operate your meter until the fuse cover is in place and fastened securely.

Specifications

| Function | Range | Resolution | Accuracy | |
|------------|---|--------------------|--|---|
| DC Voltage | 400 mV | 0.01 mV | $\pm(0.06\% \text{ reading} + 2 \text{ digits})$ | |
| | 4V | 0.0001V | | |
| | 40V | 0.001V | | |
| | 400V | 0.01V | | |
| | 1000V | 0.1V | | |
| AC Voltage | | | 40 Hz to 65 Hz | 66 Hz to 1000 Hz |
| | 400 mV | 0.01 mV | $\pm(0.5\% \text{ rdg} + 3 \text{ digits})$ | $\pm(1\% \text{ rdg} + 3 \text{ digits})$ |
| | 4 V | 0.0001 V | | |
| | 40 V | 0.001 V | | |
| | 400 V | 0.01 V | | |
| | 1000 V | 0.1 V | | |
| | All AC voltage ranges are specified from 5% of range to 100% of range | | | |
| DC Current | 400 μA | 0.01 μA | $\pm(0.7\% \text{ reading} + 3 \text{ digits})$ | |
| | 4000 μA | 0.1 μA | | |
| | 40 mA | 0.001 mA | | |
| | 400 mA | 0.01 mA | $\pm(1.0\% \text{ reading} + 3 \text{ digits})$ | |
| | 10 A | 0.00 A | $\pm(1.5\% \text{ reading} + 3 \text{ digits})$ | |
| | (20 A: 30 sec max with reduced accuracy) | | | |
| AC Current | | | 40 Hz to 65 Hz | 66 Hz to 1000 Hz |
| | 400 μA | 0.01 μA | $\pm(1.0\% \text{ rdg} + 3 \text{ digits})$ | $\pm(1.5\% \text{ rdg} + 3 \text{ digits})$ |
| | 4000 μA | 0.1 μA | | |
| | 40mA | 0.001 mA | | |
| | 400mA | 0.01 mA | | |
| | 10A | 0.001 A | $\pm(2.0\% \text{ reading} + 3 \text{ digits})$ | $\pm(2.0\% \text{ reading} + 3 \text{ digits})$ |
| | (20A: 30 sec max with reduced accuracy) | | | |

NOTE: Accuracy is stated at 65°F to 83°F (18°C to 28°C) and less than 75% RH.

| Function | Range | Resolution | Accuracy | |
|-------------------------|---|------------------------------|---|--|
| Resistance | 400 Ω | 0.01 Ω | $\pm(0.3\% \text{ reading} + 4 \text{ digits})$ | |
| | 4 k Ω | 0.0001 k Ω | | |
| | 40 k Ω | 0.001 k Ω | | |
| | 400 k Ω | 0.01 k Ω | | |
| | 4 M Ω | 0.0001 M Ω | | |
| | | 40 M Ω | 0.001 M Ω | $\pm(2.0\% \text{ reading} + 20 \text{ digits})$ |
| Capacitance | 40 nF | 0.001 nF | $\pm(3.5\% \text{ reading} + 40 \text{ digits})$ | |
| | 400 nF | 0.01 nF | | |
| | 4 μ F | 0.0001 μ F | | |
| | 40 μ F | 0.001 μ F | | |
| | 400 μ F | 0.01 μ F | | |
| | | 4000 μ F | 0.1 μ F | $\pm(5\% \text{ reading} + 10 \text{ digits})$ |
| | | 10000 μ F | 1 μ F | |
| Frequency | 40 Hz | 0.001 Hz | $\pm(0.1\% \text{ reading} + 1 \text{ digits})$ | |
| | 400 Hz | 0.01 Hz | | |
| | 4 kHz | 0.0001 kHz | | |
| | 40 kHz | 0.001 kHz | | |
| | 400 kHz | 0.01 kHz | | |
| | 4 MHz | 0.0001 MHz | | |
| | 40 MHz | 0.001 MHz | | |
| Duty Cycle | 0.1 to 99.90% | 0.01% | $\pm(1.0\% \text{ reading} + 2 \text{ digits})$ | |
| | Pulse width: 100 μ s – 100 ms, Frequency: 5 Hz to 150 kHz | | | |
| Temperature (type-K) | -50 to 1382 $^{\circ}$ F | 0.1 $^{\circ}$ F | $\pm(1.0\% \text{ reading} + 4.5^{\circ}$ F) | |
| | -45 to 750 $^{\circ}$ C | 0.1 $^{\circ}$ C | $\pm(1.0\% \text{ reading} + 2.5^{\circ}$ C) (probe accuracy not included) | |
| Temperature IR | -30 to -6 $^{\circ}$ C | 1 $^{\circ}$ C/ $^{\circ}$ F | $\pm 4^{\circ}$ C | |
| | -5 to 100 $^{\circ}$ C | | $\pm(1.0\% \text{rdg} + 2^{\circ}$ C) | |
| | 101 to 550 $^{\circ}$ C | | $\pm(2.0\% \text{rdg} + 2^{\circ}$ C) | |
| | -22 to 23 $^{\circ}$ F | | $\pm 8^{\circ}$ F | |
| | 24 to 212 $^{\circ}$ F | | $\pm(1.0\% \text{rdg} + 4^{\circ}$ F) | |
| | 213 to 1022 $^{\circ}$ F | | $\pm(2.0\% \text{rdg} + 4^{\circ}$ F) | |

| | |
|-------------------------------|--|
| Enclosure | Double molded, Waterproof (IP64) |
| Diode Test | Test current of 0.9mA maximum, open circuit voltage 2.8V DC typical |
| Continuity Check | Audible signal will sound if the resistance is less than 35Ω (approx.), test current <0.35mA |
| PEAK | Captures peaks >1ms |
| Memory | Store and recall up to 3 values |
| Temperature Sensor | Requires type K thermocouple |
| Input Impedance | >10MΩ VDC & >3MΩ VAC |
| AC Response | True rms |
| ACV Bandwidth | 40Hz to 1000Hz |
| IR Spectral response | 6 to 16μm |
| IR Emissivity | 0.95 fixed |
| IR distance ratio | 30:1 |
| Laser pointer | Class 2 laser < 1mW power; Wavelength is 630 to 670nm |
| Crest Factor | ≤3 at full scale up to 500V, decreasing linearly to ≤1.5 at 1000V |
| Display | 40,000 count backlit liquid crystal display with bargraph |
| Overrange indication | "OL" is displayed |
| Auto Power Off | 15 minutes (approximately) with disable feature |
| Polarity | Automatic (no indication for positive); Minus (-) sign for negative |
| Measurement Rate | 2 times per second, nominal |
| Low Battery Indication | "  " is displayed if battery voltage drops below operating voltage |
| Battery | One 9 volt (NEDA 1604) battery |
| Fuses | mA, μA ranges; 0.5A/1000V ceramic fast blow A range; 10A/1000V ceramic fast blow |
| Operating Temperature | 41°F to 104°F (5°C to 40°C) |
| Storage Temperature | -4°F to 140°F (-20°C to 60°C) |
| Operating Humidity | Max 80% up to 87°F (31°C) decreasing linearly to 50% at 104°F (40°C) |
| Storage Humidity | <80% |
| Operating Altitude | 7000 ft. (2000 meters) maximum |
| Weight | 0.753 lb (342 g) (includes holster) |
| Size | 7.36" x 3.2" x 2.0" (187 x 81 x 50 mm) (includes holster) |
| Safety | This meter is intended for origin of installation use and protected, against the users, by double insulation per EN61010-1 and IEC61010-1 2 nd Edition (2001) to Category IV 600V and Category III 1000V; Pollution Degree 2. |
| Approvals | CE |

Copyright © 2009 Extech Instruments Corporation.

All rights reserved including the right of reproduction in whole or in part in any form.

www.extech.com

Warranty

EXTECH INSTRUMENTS CORPORATION (a FLIR company) warrants the basic instrument to be free of defects in parts and workmanship for three years from date of shipment (a six month limited warranty applies on sensors and cables). If it should become necessary to return the instrument for service during or beyond the warranty period, contact the Customer Service Department at (781) 890-7440 EXTENSION 210 for authorization or visit www.extech.com for more information. **A Return Authorization (RA) number must be issued before any product is returned to Extech.** The sender is responsible for shipping charges, freight, insurance and proper packaging to prevent damage in transit. This warranty does not apply to defects resulting from action of the user such as misuse, improper wiring, operation outside of specification, improper maintenance or repair, or unauthorized modification. Extech specifically disclaims any implied warranties or merchantability or fitness for a specific purpose and will not be liable for any direct, indirect, incidental or consequential

Calibration and Repair Services

Extech offers repair and calibration services for the products we sell. Extech also provides NIST certification for most products. Call the Customer Service Department for information on calibration services available for this product. Extech recommends that annual calibrations be performed to verify meter performance and accuracy.



Support line (781) 890-7440

Technical support: Extension 200; E-mail: support@extech.com

Repair & Returns: Extension 210; E-mail: repair@extech.com

Product specifications subject to change without notice

For the latest version of this User's Guide, Software updates, and other up-to-the-minute product information, visit our website: www.extech.com
Extech Instruments Corporation, 285 Bear Hill Rd., Waltham, MA 02451