


IMAGE

**STITCHING** 

# HIGH-DEFINITION AUTO FOCUS MEASURING MICROSCOPE (WITH DISPLAY) **CODE 5315-S710**

ATTENTION: PLEASE MAKE CONFOCAL ADJUSTMENT AFTER CHANGING CAMERA ADAPTERS OR AUXILIARY OBJECTIVES



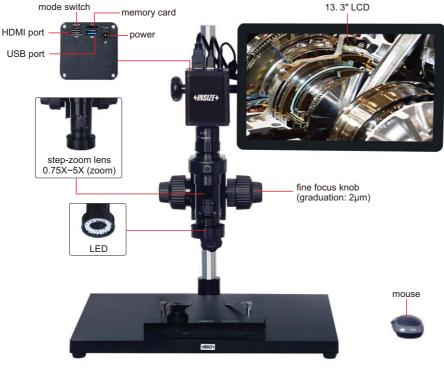


focus on the top focus on the bottom


clear image of both top and bottom

focus stacking

- 12M high-definition image
- Switchable LCD mode and computer mode
- Take pictures or videos, save to memory card
- Measurement results can be sent to Excel
- Automatic white balance and exposure

### Image stitching

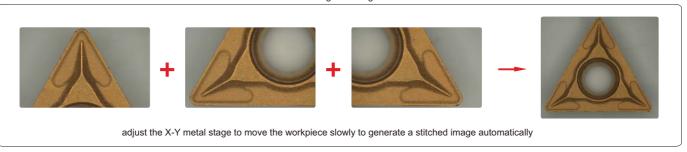

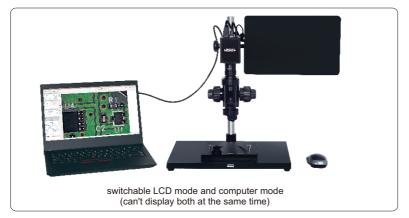

### **SPECIFICATION**

T EOII IOATION		
Magnification	15X~100X(on 13.3" LCD)	
Sensor	1/1.7" CMOS	
Pixel	12M	
Resolution	4000×3000	
Frame rate	60fps	
Output	HDMI/USB	
Power supply	power adapter	
Dimension (L×W×H)	570×300×430mm	

### STANDARD DELIVERY

Main unit	1 pc
0.5X camera adapter	1 pc
1X auxiliary objective	1 pc
Calibration plate	1 pc
32G memory card	1 pc
Mouse	1 pc
X-Y metal stage	1 pc

# OPTIONAL ACCESSORY

1X camera adapter	ISM-DL-CA1X
2X auxiliary objective	ISM-DL-OB2X
Computer	ISM-DL-COMPUTER
LED light	Page 275
Auxiliary objective	Page 276

stage moving knob X-Y metal stage (included) (X-Y travel: 100×86mm)





calibration plate (included)


1X camera adapter (optional)

2X auxiliary objective (optional)

## MAGNIFICATION AND MEASURING ACCURACY(on 13.3" LCD)

Objective magnification	Image magnification	Measuring accuracy
0.75X	15X	±2mm
1X	20X	±2mm
1.5X	30X	±2mm
2X	40X	±2mm
2.5X	50X	±2mm
3X	60X	±2mm
3.5X	70X	±2mm
4X	80X	±1mm
4.5X	90X	±1mm
5X	100X	±1mm

SOFTWARE FOR LCD(INCLUDED)

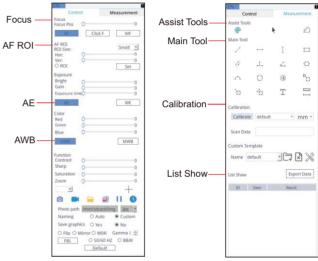

# MAGNIFICATION, FOCUS DISTANCE AND VIEW FIELD(on 13.3" LCD)

Specification	Camera adapter		
Specification	0.5X (included)	1X (optional)	
Magnification	15~100X	30~200X	
Focus distance	80±2mm	80±2mm	
View filed	20.0×11.2~5.5×3.1mm	10.0×5.6~2.7×1.5mm	

# SOFTWARE FOR COMPUTER(INCLUDED)

