
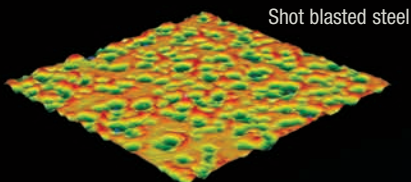
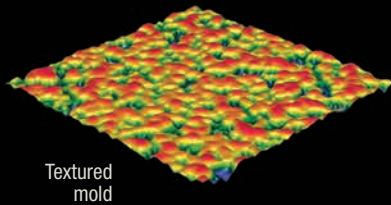


PosiTector® **RTR3D**

Replica Tape Reader

3D

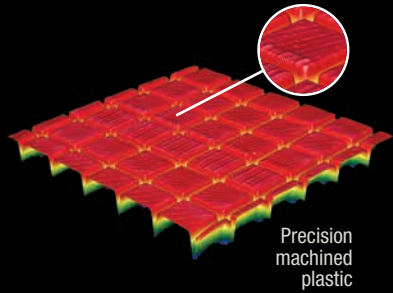

Measures and records surface profile parameters using replica tape



For use with **OPTICAL Grade**
Testex™ Press-0-Film™ Replica Tape

Advanced model shown

DeFelsko®
The Measure of Quality

 **Bluetooth®**


WiFi

Available on the
App Store



PosiTector® **RTR3D**

All Gages Feature...

Simple

- Measures peak height (H_L) and common 2D/3D profile parameters such as R_a , R_z , S_q , S_{pd} and more (see inset below)
- Enhanced one-handed menu navigation
- RESET feature instantly restores factory settings

Durable

- Solvent, acid, oil, water and dust resistant—weatherproof
- Rugged indoor/outdoor instrument—ideal for field or laboratory use; flat curved or irregular surfaces
- Shock-absorbing, protective rubber holster with belt clip
- Two year warranty on gage body AND probe

Accurate

- Certificate of Calibration (containing R_a and R_t measurements) showing traceability to an accredited national laboratory included
- Conforms to national and international standards including ISO and ASTM

Versatile

- PosiTector body accepts all PosiTector RTR, 6000, 200, SPG, DPM, SST, SHD and UTG probes easily converting from a surface profile gage to a coating thickness gage, dew point meter, soluble salt tester, Shore hardness durometer or ultrasonic wall thickness gage
- Selectable display languages
- High contrast LCD with backlit display
- Flip Display enables right-side-up viewing
- Uses alkaline or rechargeable batteries (built-in charger)

Powerful


- Calculates and records all fourteen 2D and 3D parameters (below) with each measurement
- Screen Capture—save screen images for record keeping and review
- Sealed USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.
- PosiSoft USB Drive—stored readings and graphs can be accessed using universal PC/Mac web browsers or file explorers. No software required.
- Every stored measurement is date and time stamped
- Includes PosiSoft suite of software for viewing and reporting data
- Apply short and long cutoff filters and discard lengths to optimize the analysis for a specific application
- Orient the 2D trace between horizontal, vertical and diagonal (XY, YX)

2D Parameters – ‘R’ – Profile Parameters

R_a	Roughness Average
R_q	Root mean square roughness
R_p	Maximum Profile Peak Height
R_v	Maximum Profile Valley Depth
R_t	Total Profile Height
R_z	Average Maximum Height of the Profile
R_{pc}	Peak Count per unit length

3D Parameters – ‘S’ – Height/Amplitude

H	Average maximum peak-to-valley height
S_a	Average roughness
S_q	Root mean square roughness
S_z	Maximum area peak-to-valley height
S_p	Maximum area peak height
S_v	Maximum valley depth
S_{pd}	Areal peak density

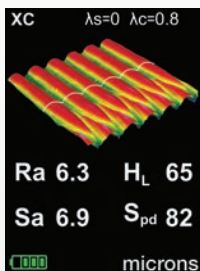

Typical display of the Advanced model

Optical Grade Tape is required for measuring 2D/3D parameters

Select Standard or Advanced Features

Standard Models

Includes ALL features as shown on left plus...


- Storage of 250 readings—stored readings can be viewed or downloaded

Advanced Models

Includes ALL features as shown on left plus...

- Storage of 100,000 readings in up to 1,000 batches
- Live graphing of measurement data
- Download high resolution Surface Data Files (.SDF) for analysis in the included PosiSoft or third-party software
- Generates two dimensional (2D) and three dimensional (3D) thumbnail images. Ideal for inclusion into reports and confirming consistent blasting results.
- WiFi technology wirelessly synchronizes with PosiSoft.net and downloads software updates
- **Bluetooth 4.0 Technology** for data transfer to a mobile device running the PosiTector App or optional portable printer. **BLE API** available for integration into third-party software.
- Onscreen Batch annotation—add notes, change batch names and more with built-in QWERTY keyboard

For a complete comparison of the Standard and Advanced features visit www.defelsko.com/RTR3D

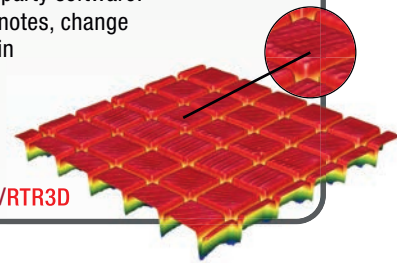

Ordering Guide	Peak Height/2D/3D
Standard	RTR3D1
Advanced	RTR3D3
Probe Only	PRBRTR3D

Measuring Range (H)	20 – 115 μ m	0.8 – 4.5 mils
Measuring Range (Rt)	10 – 115 μ m	0.4 – 4.5 mils
Minimum Roughness (R_a)	2 μ m	0.08 mil/80 μ in
Accuracy (H)	\pm 5 μ m	\pm 0.2 mil
Accuracy (Rt)*	\pm (5 μ m + 5%)	\pm (0.2 mil + 5%)
Accuracy (R_a)*	\pm (0.25 μ m + 5%)	\pm (0.01 mil + 5%)
Anvil Pressure	1.1 Newtons	110 grams-force
Anvil Size	\varnothing 6.25 mm	\varnothing 0.25 inch
Field of View	3.8 x 3.8 mm	0.149 x 0.149 inch
Lateral Sampling	3.7 μ m	0.145 mil
Vertical Resolution	100 nm - 2D/3D 10 nm - SDF	3.93 μ in - 2D/3D 0.393 μ in - SDF
Resolution	0.1 μ m	0.01 mil

* When measured using Optical Grade X-Coarse Replica Tape

ALL GAGES COME COMPLETE with one roll of Optical Grade X-Coarse tape, stainless steel burnishing tool, burnishing ball, 5 cleaning cards, check shim(s), replica tape holder, microfiber cleaning cloth, surface cleaning putty, protective rubber holster with belt clip, wrist strap, 3 AAA alkaline batteries, instructions, nylon carrying case with shoulder strap, protective lens shield, Long Form Certificate of Calibration (containing R_a and R_t values) traceable to an accredited national laboratory, USB cable, PosiSoft Software, two (2) year warranty on body and probe.

Conforms to ASME B46, ASTM D4417, ISO 8503-5, NACE SP287, SSPC-PA 17, SSPC-SP5, SP6, SP10, SP11-87T and others.


PosiSoft® Suite of Software

Four FREE and unique ways to view and report your PosiTector and PosiTest data

PosiSoft Desktop — PC/Mac

Powerful desktop software for downloading, viewing, printing and archiving measurement data. No internet connection required.

- Import readings directly from the gage via USB or from legacy PosiSoft desktop versions
- Synchronize measurement data including readings, notes and pictures to and from PosiSoft.net
- Import/Export Templates and Jobs to share with other users
- Import PDF forms and overlay **Custom Fields** for automatic population of inspection and measurement data
- Report preview automatically refreshes as changes are made

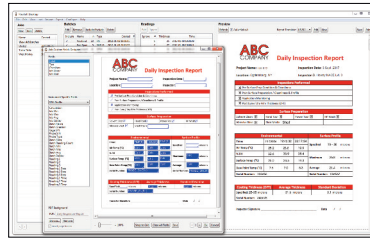

Prompted Batch Mode

Create pre-defined batches with onscreen text and image prompts for each reading and upload to PosiTector 6000 gages (*Advanced models only*).


- Ideal for ensuring a consistent measurement pattern for repetitive jobs or when specific measurement locations are required
- Create and store multiple templates for different jobs



PosiSoft.net — Web-based


A web-based application offering secure centralized management of readings. Access your data from any web-connected device.

- Synchronize data when connected via USB or WiFi
- Synchronize measurement data including readings, notes and pictures with PosiSoft Desktop and PosiTector App
- Securely store measurement data in the cloud and share with authorized users via a secure login

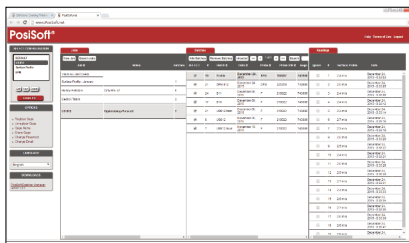

Jobs Batches Readings

PosiSoft USB Drive — Gage Based

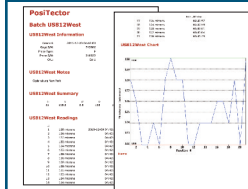

A simple gage interface to retrieve data in a manner similar to USB flash drives, cameras, or digital audio players. No software to install or internet connection required.

- View and print readings and graphs using universal PC/Mac web browsers and file explorers
- Measurement data can be printed quickly from a formatted HTML report or exported in .CSV format for further analysis in spreadsheets
- Simple file management - Copy and paste measurement data from the PosiTector to a local folder on your computer, network folder or cloud drive
- Access stored screen captures (snapshots) of the PosiTector display



PosiTector and PosiTest AT-A instruments can integrate with third-party software, drones, ROVs, PLCs, and robotic devices using several industry-standard communication protocols.

PosiTector App — Mobile

Mobile app connects PosiTector Advanced instruments, the PosiTector SmartLink and the PosiTest AT-A to your *iOS* or *Android* smart device.

- Auto pairing Bluetooth BLE connection
- Automatically generate user-formatted reports and share via email, text, cloud storage services like Dropbox, and more
- Export readings to PosiSoft Desktop or synchronize readings to and from PosiSoft.net for further reporting and archival options




PosiSoft Custom PDF Report Generator


Easily create reports from your measurement data in seconds.

featured on
PosiSoft Desktop
PosiSoft.net
PosiTector App

- Include inspection information such as on-site pictures, screen captures, notes and more to communicate important details
- Create and save multiple custom layouts as templates – insert cover pages, add logos/images, and select font and point size
- Select the information to include for each product type – charts, histograms, readings, time stamps and more
- Compile multi-batch reports from one or more probes and instrument types
- Export readings as comma separated value (.CSV) files which can easily be imported into Excel and other supporting applications

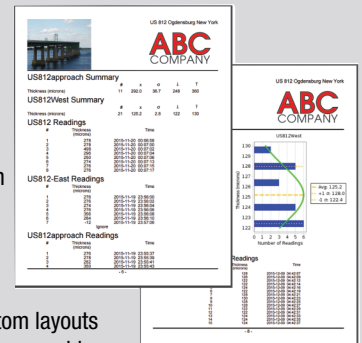

Jobs feature consolidates batches into groups to keep measurement data organized and to quickly create multi-batch reports (not available on PosiTector App)

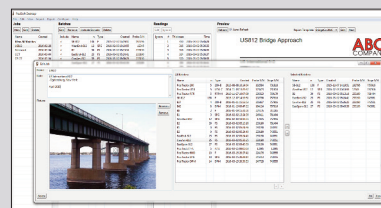

PosiTector Developer Resources

including Bluetooth 4.0, WiFi, USB Keyboard, and USB Serial

DeFelsko®
The Measure of Quality

DeFelsko Corporation • 800 Proctor Ave. • Ogdensburg, New York 13669-2205 USA
Toll Free 1-800-448-3835 • Tel: +1-315-393-4450 • Fax: +1-315-393-8471
techsale@defelsko.com • www.defelsko.com


Made in U.S.A.